





**UNITED  
TECHNOLOGIES  
CARRIER**

Commercial Division  
Carrier Corporation

BULLETIN: CA-SB-19-E-76-82  
DATE: 10/18/76  
PAGE: 2 OF: 3

## SERVICE BULLETIN

SUPERSEDE  
BULLETIN:  
DATE:  
PAGE: OF:

The final adjustment is to set the differential. Turn the differential adjustment screw (see Figs. 1 & 2) counterclockwise to decrease the differential to 10 psi. This will affect the cut-in point only, and will bring it up to 12 psi. This is represented by Point C on the graph.

The cut-in and cut-out points should be checked a couple of times for repeatability prior to reconnecting the switch to the machine.




**UNITED  
TECHNOLOGIES  
CARRIER**

Commercial Division  
Carrier Corporation

BULLETIN: CA-SB-19-E-76-82  
DATE: 10/18/76  
PAGE: 3 OF: 3

## SERVICE BULLETIN

SUPERSEDE  
BULLETIN:  
DATE:  
PAGE: OF:

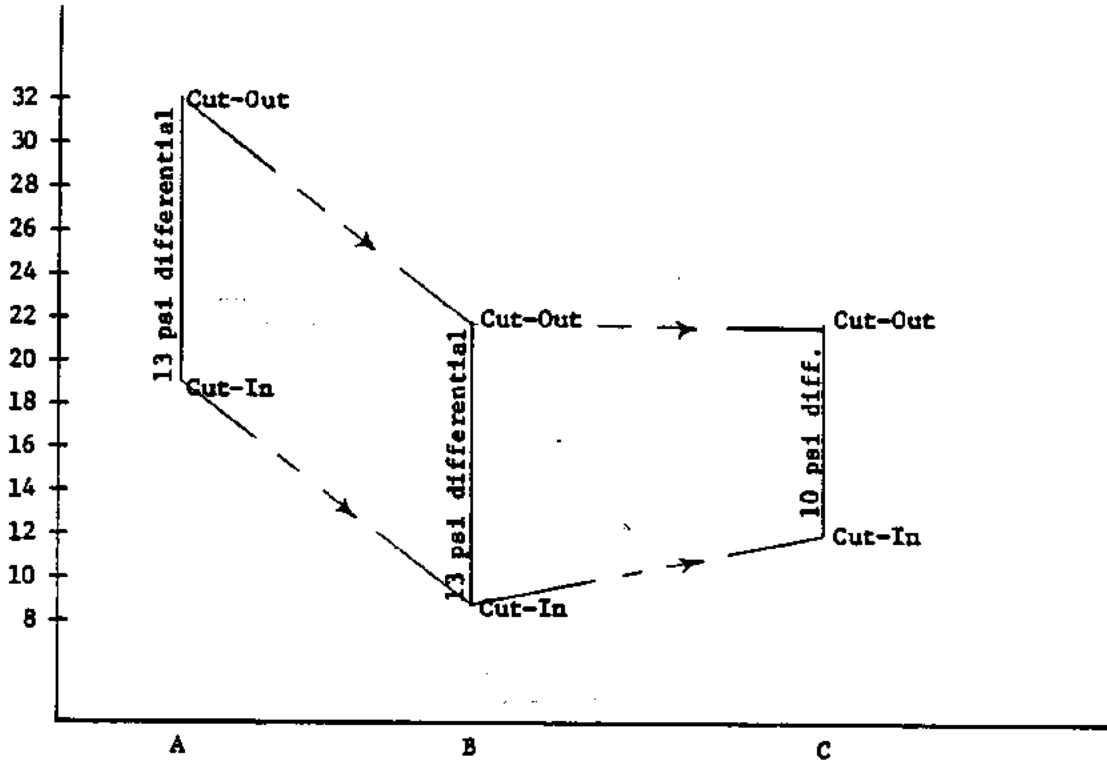

Recalibration of Misadjusted Cooler-Economizer Differential Pressure Switch

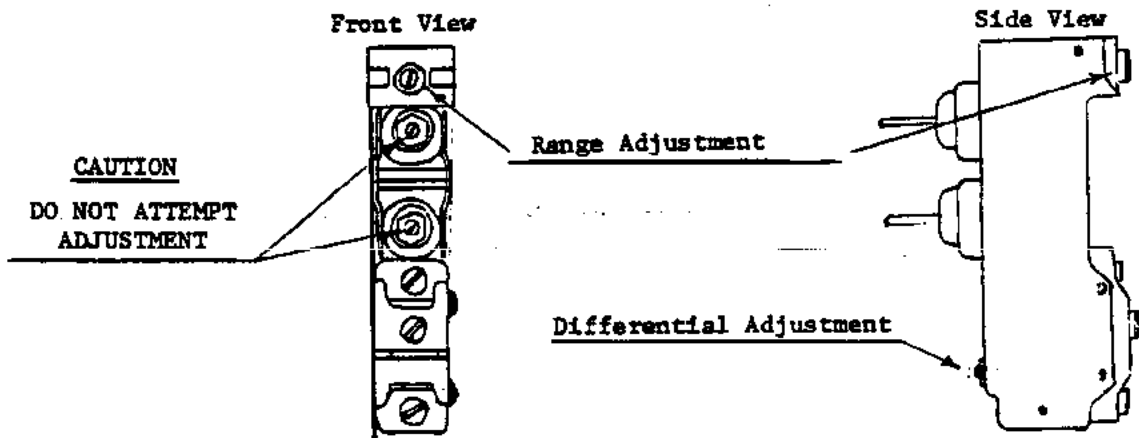


Fig. 1

Fig. 2

Cooler-Economizer Differential Pressure Switch